



Level



Pressure



Flow



Temperature



Liquid Analysis



Registration



Systems Components



Services



Solutions

Technical Information

Cerabar T PMC131, PMP131, PMP135

Pressure Transducer

With ceramic and metal sensors

For absolute pressure and gauge pressure measurement up to 400 bar

Extremely stable, overload-resistant and reliable



Application

Cerabar T is a pressure transducer for measuring absolute pressure and gauge pressure in gases, vapors, liquids and dusts.

Hygienic and threaded connections are available as process connections.

Your benefits


This compact pressure transducer impresses with its well-engineered construction:

- High reproducibility and long-term stability.
- Finely graduated measuring ranges from vacuum up to 400 bar/6000 psi.
- Ceraphire® ceramic sensor: corrosion-proof, abrasion-proof and extremely overload-resistant.
- Deployed for pressure monitoring up to SIL 2 as per IEC 61508/IEC 61511-1
- Sensors
 - Dry capacitance ceramic sensor (Ceraphire®) for measuring ranges up to 40 bar - overload-resistant, vacuum-proof, stable against alternating load
 - Piezoresistive sensor with metal diaphragm for measuring ranges up to 400 bar

Table of contents

Function and system design	3	Mechanical construction	12
Device selection	3	PMC131	12
Measuring principle	3	PMP131 and PMP135	13
Measuring system	4	PMP131	13
Input	4	PMP135	14
Measured variable	4	Weights	15
Measuring range	4	Material	15
Output	4	Operating elements	15
Output signal	4	Operating elements	15
Load	4	Certificates and approvals	17
Output signal	4	CE mark	17
Output current	4	Ex approvals	17
Power	5	Pressure Equipment Directive (PED)	17
Switch frequency	5	Functional safety SIL 2/IEC 61508/IEC 61511-1	17
Input PLC	5	Hygiene standard	17
Inductive loads	5	Standards and guidelines	17
Power supply	5	Registered trademarks	17
PMC131	5	Ordering information	18
PMP131 and PMP135	6	PMC131	18
Supply voltage	7	PMC131 (continued)	19
Residual ripple	7	PMP131	20
Cable entry	7	PMP131 (continued)	21
Performance characteristics	8	PMP135	22
Reference operating conditions	8	Accessories	23
Long-term stability	8	Welding neck with sealing taper	23
Maximum measured error of analog output (under reference operating conditions)	8	Welding neck with sealing surface	23
Switch point	8	Plug-in jack	23
Rise time (T90)	8	Plug-on display PHX20/PHX21	23
Settling time	8	Documentation	24
Thermal change of the lower range value and the span	9	Field of Activities	24
Temperature coefficient (TK) for lower range value and span	9	Technical Information	24
Operating conditions (Installation instructions)	9	Operating Instructions	24
Orientation	9	Functional Safety Manual (SIL)	24
Installation instructions	9	Safety Instructions	24
Location dependence	9		
Operating conditions (environment)	10		
Ambient temperature range	10		
Storage temperature range	10		
Climate class	10		
Degree of protection	10		
Vibration resistance	10		
Electromagnetic compatibility	10		
Operating conditions (process)	11		
Process temperature range	11		
Overload resistance	11		
Vacuum resistance	11		
Pressure specifications	11		

Function and system design

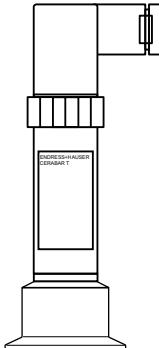Device selection	Cerabar T	PMC131	PMP131	PMP135
		 P01-PMC131xx-14-xx-xx-xx-000	 P01-PMP131xx-14-xx-xx-xx-000	 P01-PMP135xx-14-xx-xx-xx-000
		With capacitive measuring cell and ceramic measuring diaphragm (Ceraphire®)	With piezoresistive measuring cell and metallic measuring diaphragm	With piezoresistive measuring cell and metallic measuring diaphragm for hygienic applications
Field of application	Absolute pressure and gauge pressure	Absolute pressure and gauge pressure	Absolute pressure and gauge pressure in hygienic processes	
Output	4 to 20 mA	– 4 to 20 mA – Switch output PNP	– 4 to 20 mA – Switch output PNP	
Process connection	Thread: – G ½ – ½ MNPT and ¼ FNPT – G ½, bore 11 mm	Thread: – G ½ – ½ MNPT and ¼ FNPT – ½ MNPT, bore 4 mm – G ¼ – ¼ MNPT, bore 3.5 mm	Hygiene: – Clamp DN 22 (¾") – Tri-Clamp DN 25 to 38 (1" to 1½") – Tri-Clamp DN 40 to 51 (2") – G 1 – SMS 1½"	
Measuring range	–1 to 0 bar/–100 to 0 kPa up to 0 to 40 bar/0 to 4 MPa	0 to 1 bar/0 to 100 kPa up to 0 to 400 bar/0 to 40 MPa	0 to 1 bar/0 to 100 kPa up to 0 to 40 bar/0 to 4 MPa	
Process temperature	–20 to +100 °C	–25 °C to +70 °C	–25 to +100 °C (+135 °C for max. 1 hour)	

Measuring principle

PMC131


The measuring pressure causes a slight deflection of the ceramic diaphragm of the sensor. The pressure-proportional change in capacitance is measured at the electrodes of the ceramic sensor. The ceramic sensor is a dry sensor, i.e. no fill fluid is required for the pressure transfer. This makes the sensor completely suitable for vacuums. Extremely high stability, comparable with the material Alloy, is achieved by using ultrapure Ceraphire® as the ceramic.

PMP131 and PMP135 with analog output

The process pressure acting upon the metallic separating diaphragm of the sensor is transmitted to a resistance bridge via a fluid. The pressure-proportional change of the bridge output voltage is measured and processed further.

PMP131 and PMP135 with switch output

The process pressure acting upon the metallic separating diaphragm of the sensor is transmitted to a resistance bridge via a fluid. A differential amplifier creates a standard signal from the pressure-proportional change in output voltage of the bridge. A comparator with an adjustable hysteresis compares this signal with the pre-set switch point and then activates the transistor output.

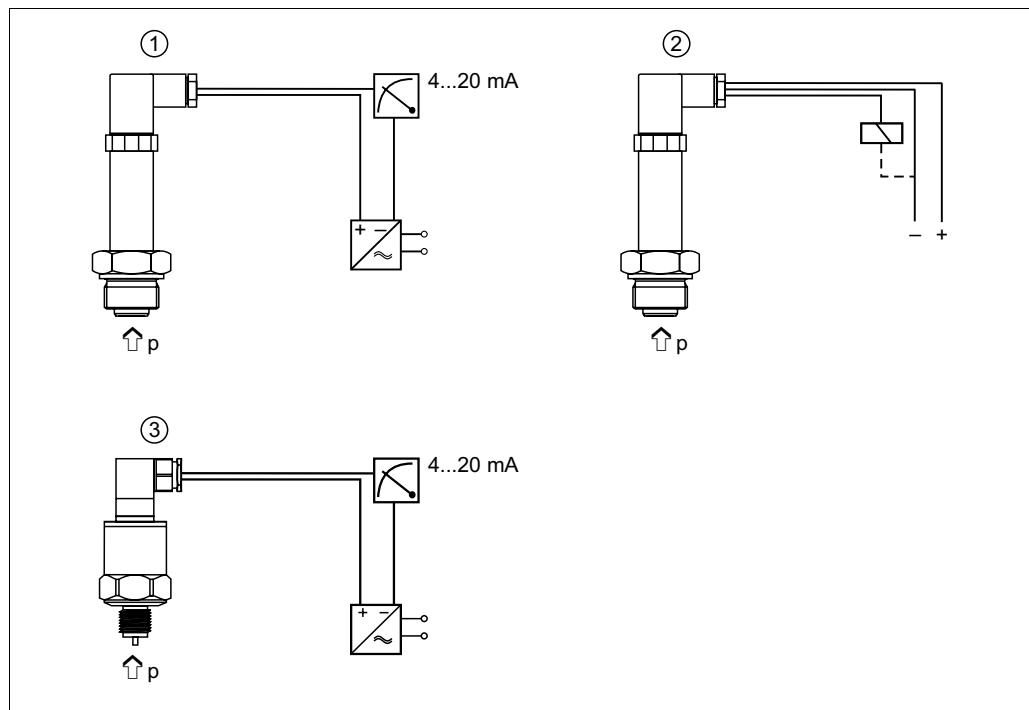Measuring system

- 1 PMP131, PMP135: analog output with transmitter power supply unit, e.g. RN 221N from Endress+Hauser
- 2 PMP131, PMP135: switch output with load, e.g. PLC, DCS, relay
- 3 PMC131: analog output with transmitter power supply unit, e.g. RN 221N from Endress+Hauser

Input

Measured variable	Absolute pressure or gauge pressure
--------------------------	-------------------------------------

Measuring range	up to 400 bar/6000 psi, see Page 18, "Ordering information" section
------------------------	---

Output**Analog output (PMC131, PMP131, PMP135)**

Output signal	4 to 20 mA
----------------------	------------

Load	PMC131 $R_{L\max} [\Omega] \leq (U_S - 1 \text{ V}) / 0.02 \text{ A}$
-------------	---

PMP131 and PMP135	$R_{L\max} [\Omega] \leq (U_S - 12 \text{ V}) / 0.02 \text{ A}$
--------------------------	---

$R_{L\max}$: Maximum load resistance
 U_S : Supply voltage

Switch output (PMP131, PMP135)

Output signal	PNP switch output (positive voltage signal), rate depends on power supply voltage
----------------------	--


Output current	<ul style="list-style-type: none"> ■ Switch status ON: $I_a \leq 500 \text{ mA}$ ■ Switch status OFF: $I_a \leq 1 \text{ mA}$
-----------------------	---

Power	max. 6 W
Switch frequency	max. 10 Hz
Input PLC	<ul style="list-style-type: none"> ■ Input resistance $R_i \leq 2 \text{ k}\Omega$ ■ Input current $I_i \geq 10 \text{ mA}$
Inductive loads	To prevent electrical interference, only operate an inductive load (relays, contactors, solenoid valves) when directly connected to a protective circuit (free-wheeling diode or capacitor).

Power supply

PMC131


Plug/cable connection

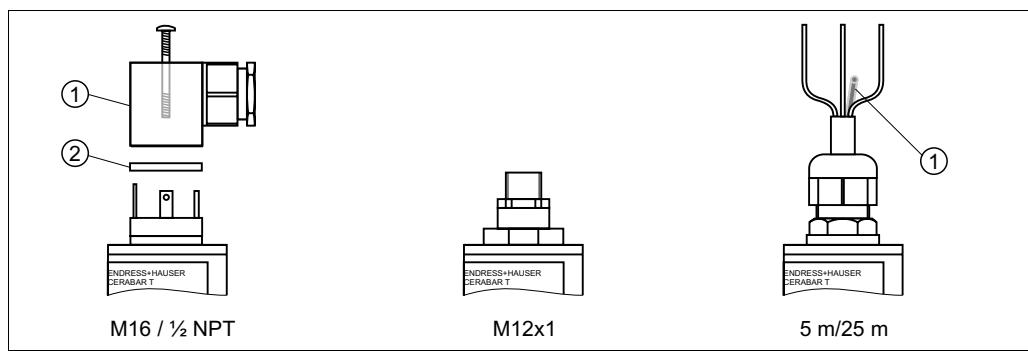

P01-PMC131xx-04-xx-xx-xx-001

Plug M 16 x 1.5 / 1/2 NPT	Plug M 12x1	5 m/25 m cable
① Plug-in housing		① Reference pressure line
② Gasket		

Electrical connection

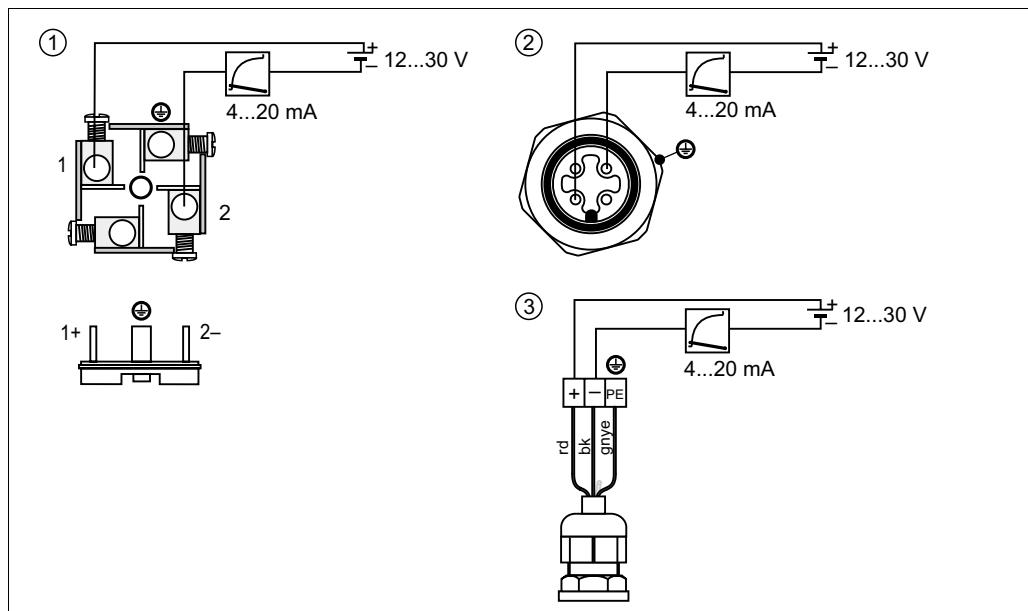


P01-PMC131xx-04-xx-xx-xx-002

1 Plug M 16 x 1.5 or 1/2 NPT

2 Plug M 12 X 1


3 Cable (rd = red, bk = black, gnye = green-yellow)

PMP131 and PMP135

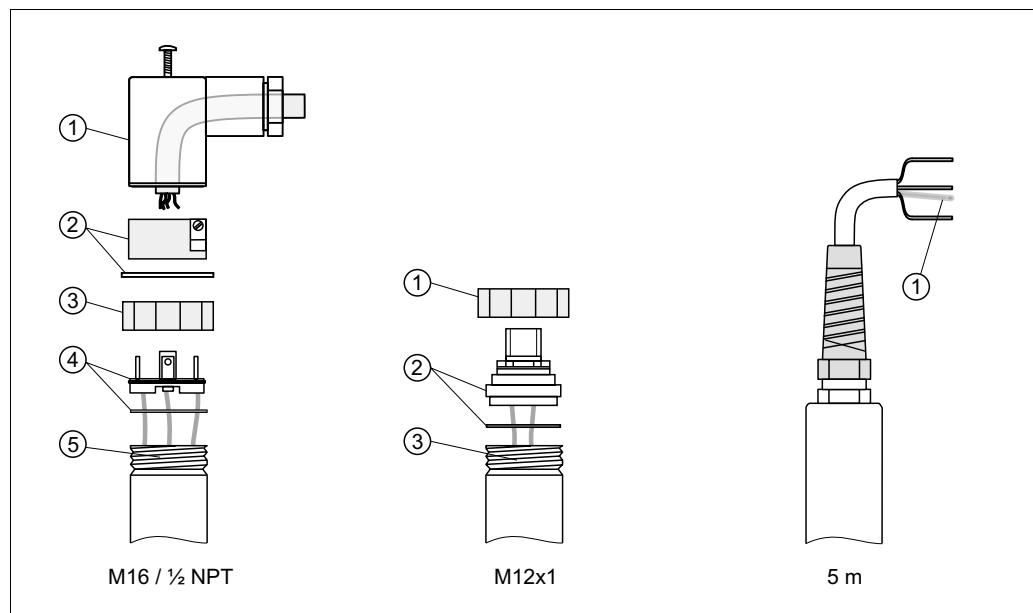Plug/cable connection


P01-PMP13xxx-04-xx-xx-xx-001

Plug M 16 x 1.5/½ NPT	Plug M 12x1	5 m cable, only analog output
① Plug-in housing	① Coupling nut	① Reference pressure line
② Plug-in jack with gasket	② Connector with gasket	
③ Coupling nut	③ Operating potentiometer (inner)	
④ Plug with O-ring		
⑤ Operating potentiometer (inner)		

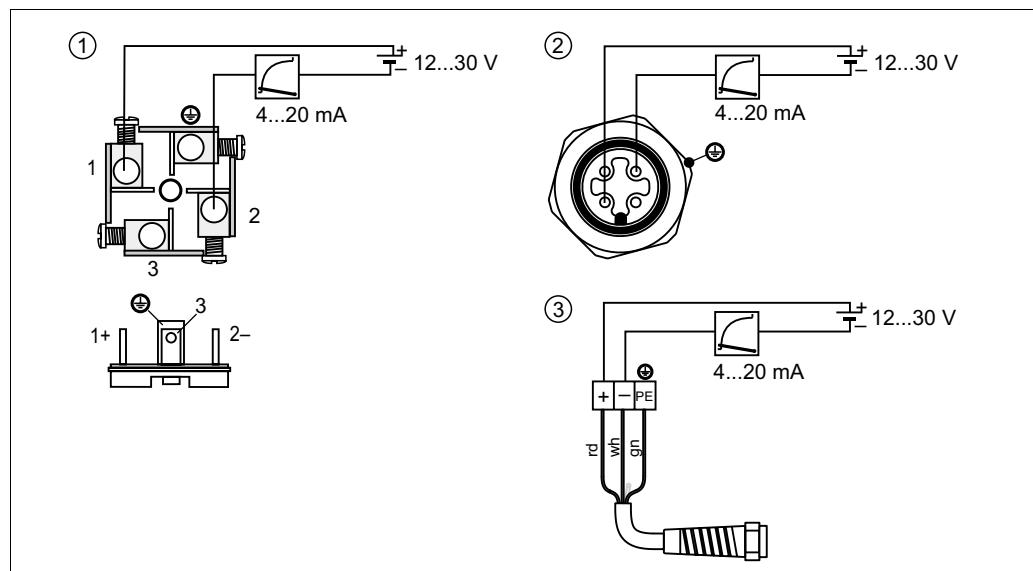Electrical connection (analog output)

P01-PMP13xxx-04-xx-xx-xx-002

1 *Plug M 16 x 1.5 or 1/2 NPT*2 *Plug M 12 X 1*3 *Cable (rd = red, wh = white, gn = green)*

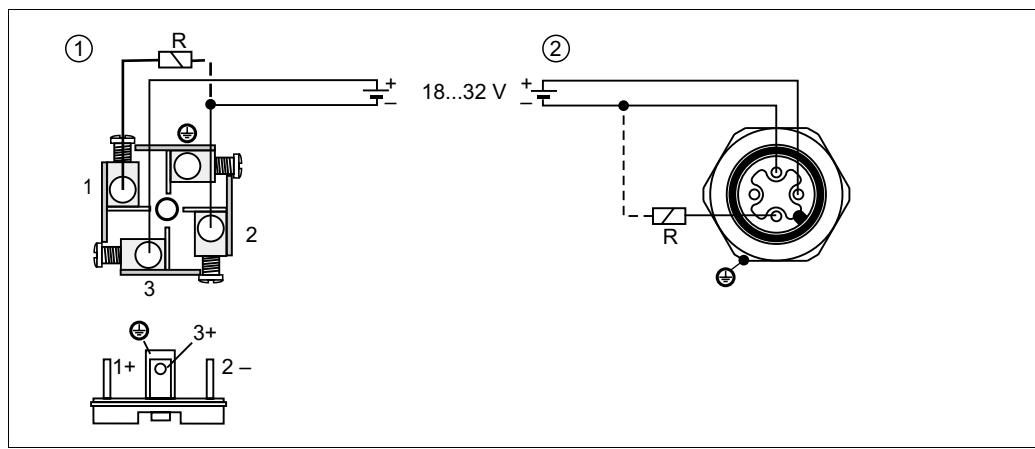Electrical connection (switch output)1 *Plug M 16 x 1.5 or 1/2 NPT*2 *Plug M 12 X 1*R *External load, e.g. relay, programmable logic controller, distributed control system***Supply voltage****PMC131**

11 to 30 V DC

PMP131 and PMP135 (analog output)

- For non-hazardous areas: 12 to 30 V DC
- Ex i: no-load voltage \leq 26 V DC, short-circuit current \leq 100 mA, power consumption \leq 0.8 W

PMP131 and PMP135 (switch output)

- 18 to 32 V DC, current consumption without load $<$ 20 mA, with reverse polarity protection


Residual ripple

- Analog output: max. 5 % of supply voltage
- Switch output: max. 10 % of supply voltage

Cable entry

→ See Page 18, "Ordering information" section.

Performance characteristics

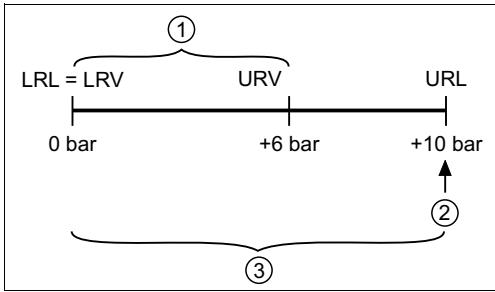Reference operating conditions	as per DIN IEC 60770, $T_U = 25 \text{ }^\circ\text{C}$
Long-term stability	$\leq 0.15 \text{ % of URL per year}$
Maximum measured error of analog output (under reference operating conditions)	The measured error comprises the non-linearity including hysteresis and non-reproducibility in accordance with the limit point method as per IEC 60770.
PMC131	<p>■ $\leq 0.5 \text{ % of (URL - LRL) x TD}$</p> <p><i>Example: PMC131 version "A1R"</i></p> <ul style="list-style-type: none"> ■ Nominal value = 10 bar ■ Upper range value (URV) = 6 bar ■ Lower range value (LRV) = 0 bar <p><i>Turn down (is set at factory):</i></p> <ul style="list-style-type: none"> ■ Nominal value / $(URV - LRV)$ = $10 \text{ bar} / 6 \text{ bar} = 10:6$  <p>P01-PMx13xxx-05-xx-xx-xx-001</p>
PMP131 and PMP135	<p>■ $\leq 0.5 \text{ % of URL}$</p>
Switch point	PMP131 and PMP135
	<ul style="list-style-type: none"> ■ Deviation: $\leq 1 \text{ % of URL}$ ■ Non-reproducibility: $\leq 0.5 \text{ % of URL}$
Rise time (T90)	PMC131 20 ms
Settling time	PMP131 and PMP135 2 to 5 ms

Thermal change of the lower range value and the span	PMC131
	Zero output, -20 to +85 °C: ■ typically 1.5 % of URL
	Output span, -20 to +85 °C: ■ Nominal value 0.4 to 40 bar: typically 0.8 % of URL ■ Nominal value 0.1bar: typically 1.0 % of URL
Temperature coefficient (T_K) for lower range value and span	PMP131 and PMP135 (analog output)
	Zero output: ■ typically: 0.2 % of URL/10 K ■ max.: 0.5 % of URL/10 K ■ Nominal value \leq 6 bar: by 0.1 % of URL/10 K higher
	Output signal: ■ typically: 0.2 % of URL/10 K ■ max.: 0.5 % of URL/10 K
	PMP131 and PMP135 (switch output)
	Switch point: ■ typically: 0.2 % of URL/10 K ■ max.: 0.5 % of URL/10 K

Operating conditions (Installation instructions)

Orientation	anywhere
Installation instructions	PMP131 Process connection G 1/2 flush-mounted, max. torque 40 Nm
Location dependence	PMC131 without influence

PMP131 and PMP135
Position-dependent zero point shift can be corrected by potentiometer setting, see also Page 16.

Operating conditions (environment)

Ambient temperature range

PMC131
–20 to +85 °C

PMP131 and PMP135

- For non-hazardous areas: –25 to +70 °C
- Ex i: –25 to +65 °C

Storage temperature range

PMC131
–50 to +100 °C

PMP131 and PMP135

–40 to +85 °C

Climate class

PMC131
4K4H as per DIN EN 60721-3

PMP131 and PMP135

4Z
with Z = 70 °C as per VDI/VDE 3540

Degree of protection

PMC131

- Plug M16 or ½ NPT: IP 65/NEMA 4X
- Plug M12x1: IP 65/ NEMA 4
- Cable: IP 68/NEMA 6P (1 mWS/24 h)

PMP131 and PMP135

- Plug M16 or ½ NPT: IP 65/NEMA 4X
- Plug M 12x1 and gauge pressure sensors: IP 65/NEMA 4X
- Plug M 12x1 and absolute pressure sensors: IP 68/NEMA 6P (1 mWS/24 h)
- Cable: IP 68/NEMA 6P (1 mWS/24 h)

Vibration resistance

4M5 as per DIN EN 60721-3

Electromagnetic compatibility

PMC131

Interference emission as per EN 61326 electrical device class B,
Interference immunity as per EN 61326 appendix A (industrial use).

PMP131 and PMP135

Interference emission as per EN 61326 electrical device class B,
Interference immunity as per EN 61326 appendix A (industrial use) and NAMUR recommendation NE 21.


Operating conditions (process)

Process temperature range	PMC131 <ul style="list-style-type: none"> ■ –20 to +100 °C ■ Devices for oxygen application: –10 to +60 °C (Version "S" for feature 30 "Sensor gasket") PMP131 –25 to +70 °C
Overload resistance	→ See Page 18, "Ordering information" section.
Vacuum resistance	PMC131 <ul style="list-style-type: none"> ■ with URV > 200 mbar/> 80 inH₂O/> 1.5 psi: 0 mbar_{abs} ■ with URV = 200 mbar/= 50 inH₂O or 80 inH₂O: 500 mbar_{abs} (Versions "D12", "D38", "W6O", "S4N") ■ with URV = 20 mbar or 100 mbar/=1.5 psi/=15 inH₂O or 30 inH₂O: 700 mbar_{abs} (Versions "D10", "D3W", "D31", "Q4D", "V6F", "W6N", "W6R") PMP131 and PMP135 10 mbar _{abs}
Pressure specifications	<ul style="list-style-type: none"> ■ The MWP (maximum working pressure) of the device is specified on the nameplate. It depends on the weakest element, with regard to pressure, of the selected components. See the following sections: – → Page 18 ff, "Ordering information" section, feature 50 "Measuring range; MWP; Nominal value; OPL" or "Sensor range; MWP; OPL". – → Page 12 ff, "Mechanical construction" section. The MWP specification on the nameplate is based on a reference temperature of +20 °C and can be present over an unlimited period of time. ■ The test pressure corresponds to the overload limit of the measuring device (Over Pressure Limit OPL) and must only be present for a limited period of time.

Mechanical construction

PMC131

Housing

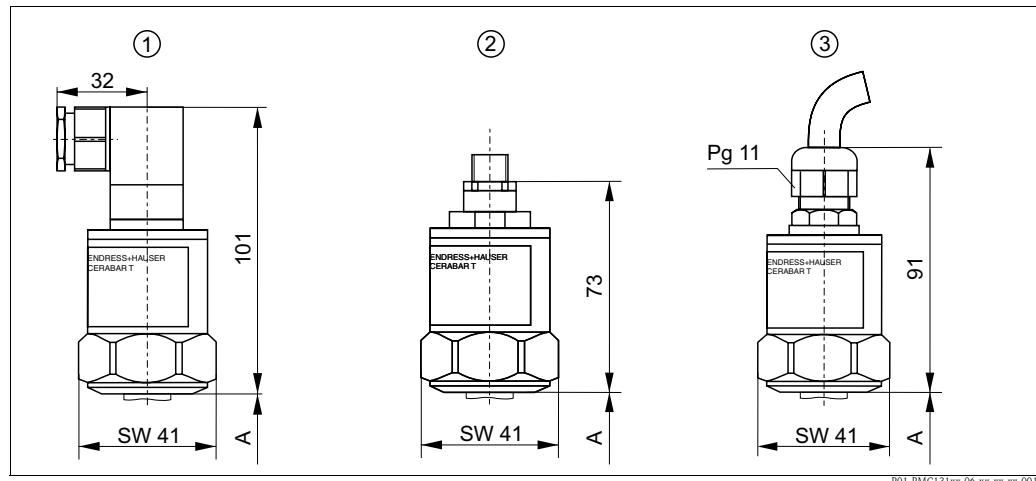


Housing PMC131; Material AISI 304 (1.4301)

- 1 Versions A1, A2, B1, C1, C2: Plug M 16 or $\frac{1}{2}$ NPT (ISO 4400), IP 65
- 2 Versions A5, B5, C5: Plug M 12, IP 65
- 3 Versions A3, A4, B3, C3: 5 m or 25 m cable, IP 68

→ See the following diagram for the height of process connection A

Process connections

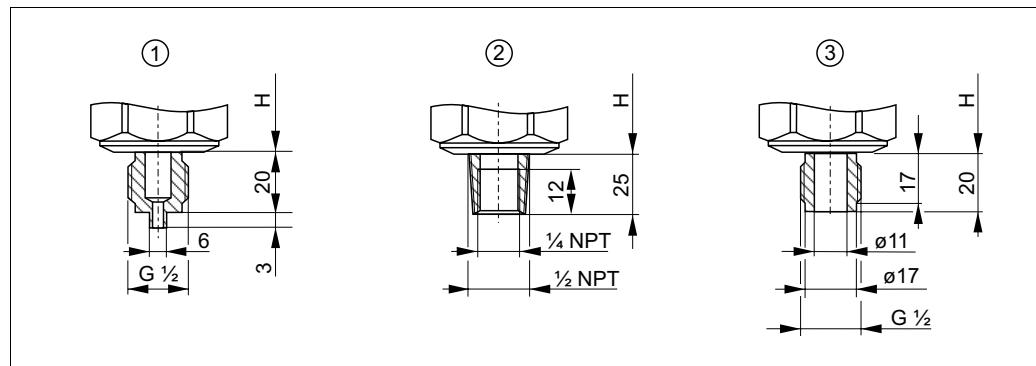


Process connections PMC131; Material AISI 304 (1.4301)

- 1 Version 1: Thread ISO 228 G $\frac{1}{2}$
- 2 Version 2: Thread ANSI $\frac{1}{2}$ MNPT $\frac{1}{4}$ FNPT
- 3 Version 5: Thread ISO 228 G $\frac{1}{2}$, bore 11 mm

→ See respective housing for installation height H

PMP131 and PMP135

Housing

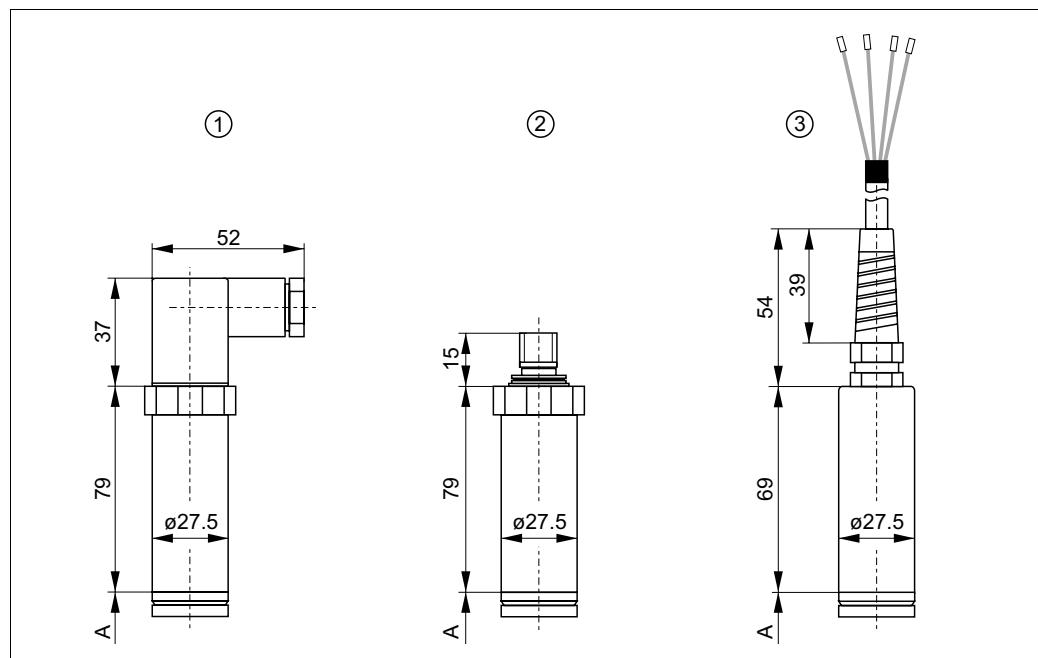


Housing PMP131 and PMP135; Material AISI 304 (1.4301)

- 1 Versions A1, A2: Plug M 16 or 1/2 NPT (ISO 4400), IP 65
- 2 Version A3: 5 m cable, IP 68
- 3 Version A4: Plug M 12, IP 65

→ See the following diagram for the dimensions of process connection A

PMP131


Process connections

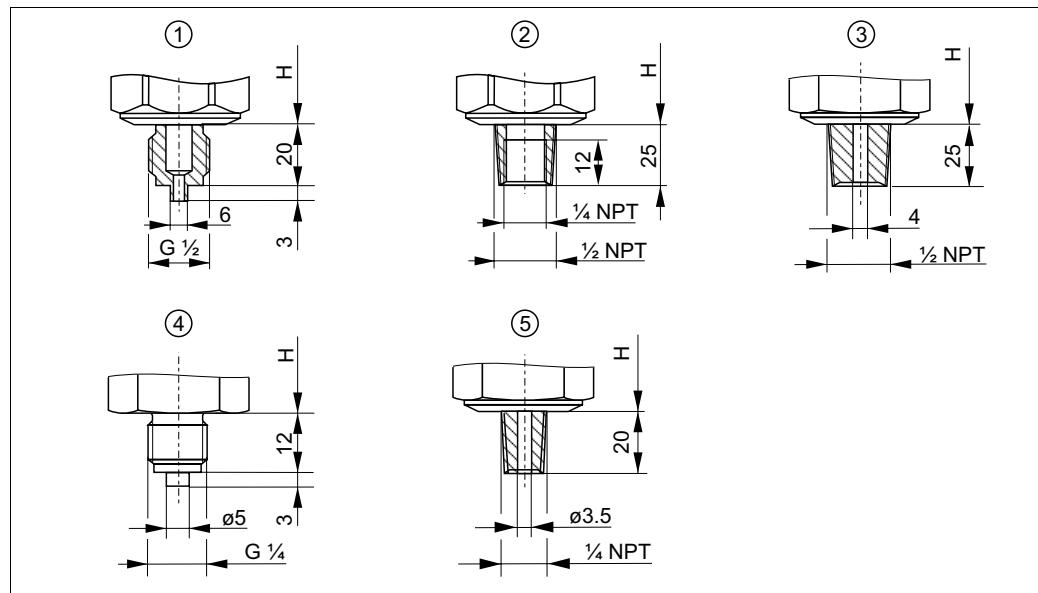

Process connections PMP131; Material AISI 304 (1.4301)

- 1 Version 1: Thread ISO 228 G 1/2
- 2 Version 2: Thread ANSI 1/2 MNPT 1/4 FNPT
- 3 Version 3: Thread ANSI 1/2 MNPT, bore 4 mm female
- 4 Version 4: Thread ISO 228 G 1/4
- 5 Version 5: Thread ANSI 1/4 MNPT, bore 3.5 mm female

→ See respective housing for installation height H

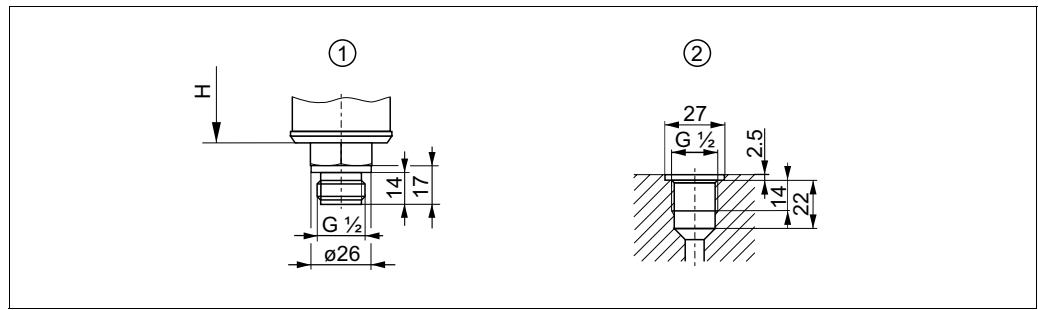


Process connection PMP131; Material AISI 304 (1.4301)

- 1 Version B: Thread ISO 228 G 1/2, Gasket DIN 3852 flush-mounted
2 Dimensions for tapped hole G 1/2 as per DIN 3852-11 form X

→ See respective housing for installation height H

PMP135

Process connections

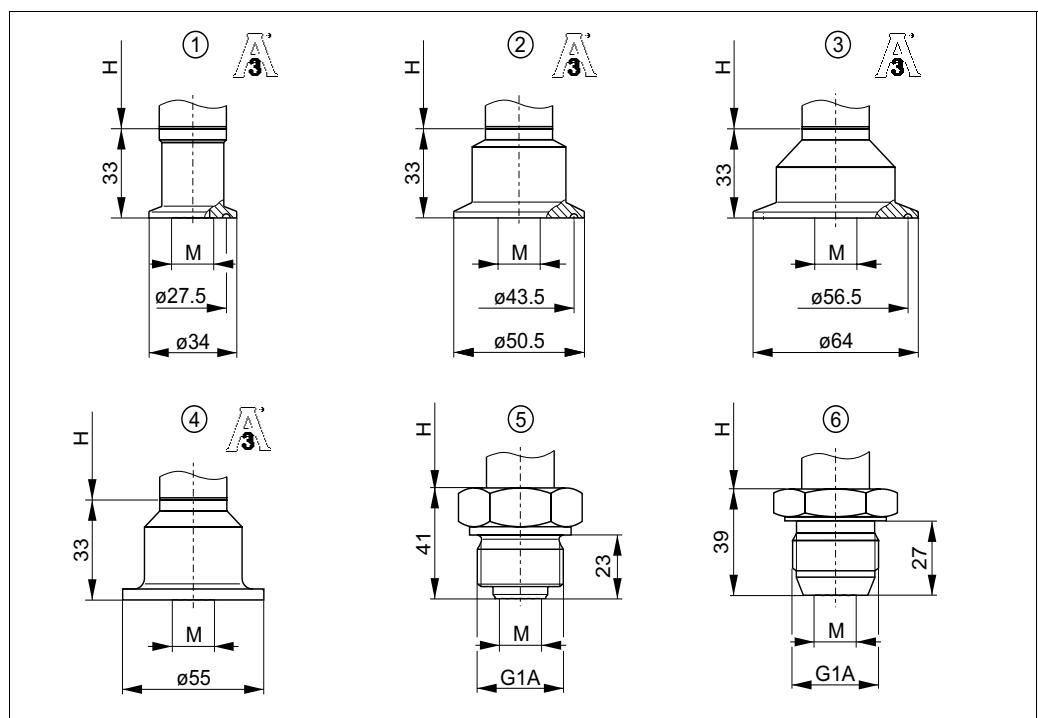



Process connections PMP135; Material AISI 316L (1.4435); Surface roughness of the surfaces in contact with the medium $R_a \leq 0.8 \mu\text{m}$
M = Diaphragm diameter 17.2 mm

- 1 Version F: Clamp 3/4" (ISO 2852) or DN 22 (DIN 32676), 3A
2 Version G: Tri-Clamp 1" to 1 1/2" (ISO 2852) or DN 25 to DN 40 (DIN 32676), 3A
3 Version H: Tri-Clamp 2" (ISO 2852) or DN 50 (DIN 32676), 3A
4 Version S: SMS 1 1/2" PN 25, 3A
5 Version N: G1A (ISO 228), with sealing surface for flush-mounted installation
6 Version M: G1A (ISO 228), with metallic sealing taper, flush-mounted

→ See respective housing for installation height H


Weights	<ul style="list-style-type: none"> ■ PMC131: approx. 0.32 kg ■ PMP131: approx. 0.24 kg ■ PMP135: approx. 0.34 kg
Material	<ul style="list-style-type: none"> ■ Process connection: <ul style="list-style-type: none"> – PMC131: AISI 304 (1.4301) – PMP131: AISI 304 (1.4301) – PMP135: AISI 316L (1.4435) ■ Sensor diaphragm: <ul style="list-style-type: none"> – PMC131: Ceraphire® (99.9 % Al₂O₃), FDA number 21-CFR 186.1256 – PMP131, PMP135: AISI 316L (1.4435) ■ Fill oil: <ul style="list-style-type: none"> – PMP131: Tegiloxan 3 – PMP135: Mineral oil, FDA number 21-CFR 172.882 ■ Housing AISI 304 (1.4301) ■ Electrical connection Plug M12: Polyamide (PA) Valve connector: Sheathing made of polyamide (PA) Cable: Sheathing made of polyurethane (PUR/UL94, V0, UV-resistant)

Operating elements

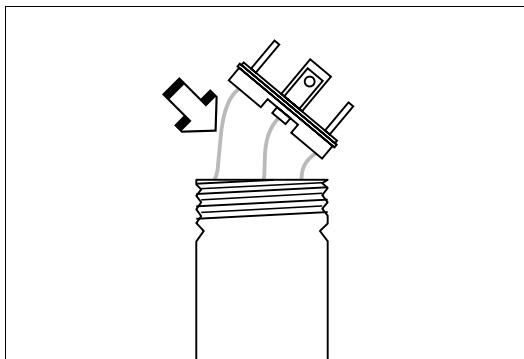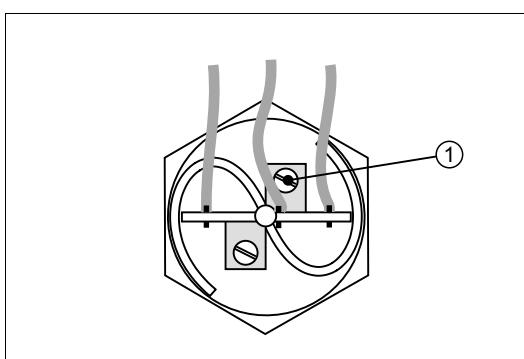Operating elements	Position of operating elements	
	<p>Position of operating elements</p>  <p>P01-PMx13xxx-19-xx-xx-xx-003</p>	<p>The potentiometer for operating the Cerabar T PMP131 and PMP135 with analog or switch output is located below the base of the plug.</p>
Analog output: Zero point adjustment	 <p>P01-PMx13xxx-19-xx-xx-xx-001</p>	<p>The zero point can be corrected for the Cerabar T PMP131 and PMP135 with analog output and plug version.</p>

1 Potentiometer for zero point correction by $\pm 5\%$ of URL


Switch output: Switch point and hysteresis adjustment

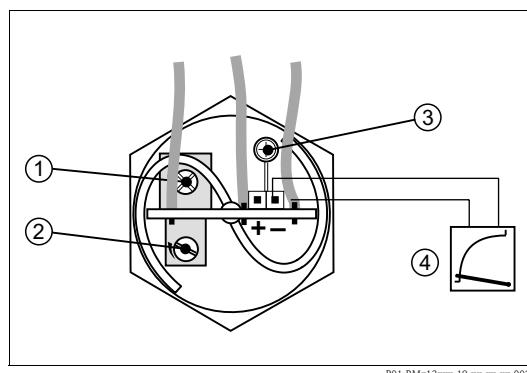

For the Cerabar T PMP131 and PMP135 with switch output, both the switch point and hysteresis can be adjusted.

This can also be carried out at atmospheric pressure using the enclosed test cable and a voltmeter.

- 1 Hysteresis adjustment 1.5 to 20 % of URL;
Factory setting 10 % of URL
- 2 Switch point adjustment 0 to 100 % of URL;
Factory setting 50 % of URL
- 3 LED color code for checking the switch status:
green = off; red = on
- 4 Connect voltmeter to test pins:
0 to 1 V corresponds to 0 to 100 % of URL

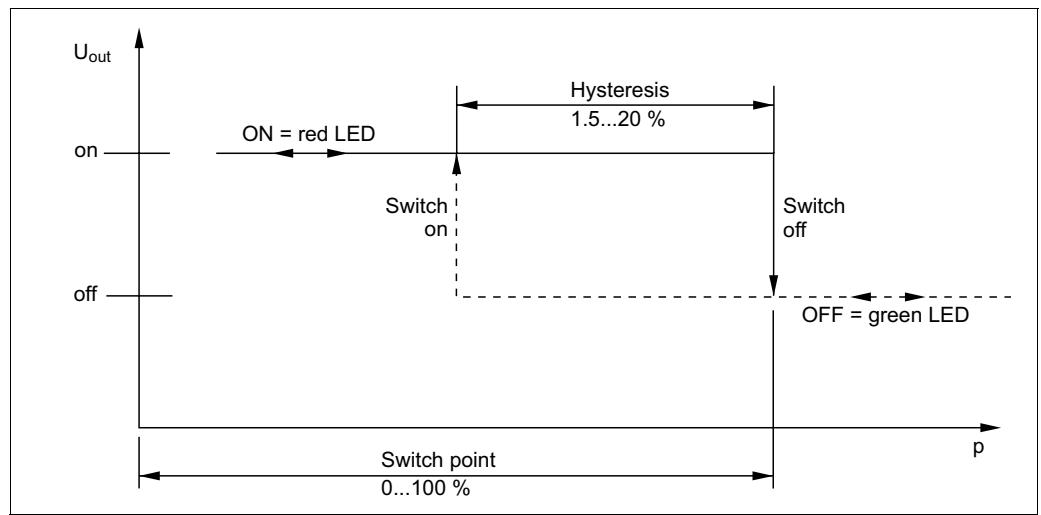

Instructions for switch point and hysteresis (the percentage values refer to the URL)

U_a Output voltage
 p Acting pressure

Certificates and approvals

CE mark	The device meets the legal requirements of the EC directives. Endress+Hauser confirms that the device has been successfully tested by applying the CE mark.
Ex approvals	All explosion protection data are given in separate documentation which is available upon request. The Ex documentation is supplied as standard with all devices approved for use in explosion hazardous areas. → See also Page 22, "Safety Instructions" section.
Pressure Equipment Directive (PED)	This measuring device corresponds to Article 3 (3) of the EC directive 97/23/EC (Pressure Equipment Directive) and has been designed and manufactured according to good engineering practice.
Functional safety SIL 2/ IEC 61508/IEC 61511-1	The Cerabar T PMP131 and PMP135 pressure transducers with 4 to 20 mA electronics have been assessed by an independent body according to the standards IEC 61508/IEC 61511-1. These devices can be used for monitoring process pressure up to SIL 2. → For a detailed description of safety functions with Cerabar T, settings and characteristic quantities for functional safety, see the "Functional Safety Manual – Cerabar T SD160P".
Hygiene standard	Many versions of the Cerabar T PMP135 meet the requirements of the 3A-Sanitary Standard No. 74-2. Endress+Hauser confirms this by applying the 3A symbol.
Standards and guidelines	<p>DIN EN 60770 (IEC 60770): Transmitters for controlling in systems used in industrial process technology Part 1: Methods for evaluating the operating behavior.</p> <p>DIN EN 61003-1, Edition:1993-12 Systems used in industrial process technology; Devices with analog inputs and two-point or multi-point behavior; Part 1: Methods for evaluating the operating behavior.</p> <p>DIN 16086: Electrical pressure measuring devices, pressure sensors, transmitters, pressure measuring devices Terms, specifications in data sheets.</p> <p>IEC 60592 Degrees of protection provided by enclosures (IP-Code).</p> <p>EN 61326: Electrical equipment for control technology and laboratory application – EMC requirements.</p> <p>IEC 61010 Safety requirements for electrical equipment for measurement, control and laboratory use.</p> <p>NAMUR Association for Standards for Control and Regulation in the Chemical Industry.</p>
Registered trademarks	Ceraphire® Registered trademark of Endress+Hauser GmbH+Co. KG, Maulburg, Germany (→ See also www.endress.com/ceraphire)

Ordering information

PMC131

10	Electrical connection:				
A1	Plug ISO 4400, M 16, IP 65/NEMA 4X				
A2	Plug ISO 4400, ½ NPT, IP 65/NEMA 4X				
A3	5 m cable, IP 68/NEMA 6P				
A4	25 m cable, IP 68/NEMA 6P				
A5	Plug M 12, IP 65/NEMA 4				
B1	Plug ISO 4400, M 16, IP 65, ATEX II 3 G EEx nA II T4				
B3	5 m cable, IP 68, ATEX II 3 G EEx nA II T4				
B5	Plug M 12, IP 65, ATEX II 3 G EEx nA II T4				
C1	Plug ISO 4400, M 16, NEMA 4X, CSA GP				
C2	Plug ISO 4400, ½ NPT, NEMA 4X, CSA GP				
C3	5m cable, IP 68/NEMA 6P, CSA GP				
C5	Plug M12, IP 65/NEMA 4, CSA GP				
20	Process connection:				
1	Thread ISO 228 G ½, AISI 304				
2	Thread ANSI ½ MNPT ¼ FNPT, AISI 304				
5	Thread ISO 228 G ½ bore 11 mm, AISI 304				
30	Sensor seal:				
F	FKM Viton				
S	FKM Viton, oxygen application				
40	Additional options:				
1	Without additional equipment				
S	GL (German Lloyd) marine certificate				
2	Final inspection report				
50	Measuring range; MWP; Nominal value; OPL:				
		Measuring range	MWP (Maximum Working Pressure)	Nominal value	OPL (Over Pressure Limit)
		Sensors for gauge pressure			
	A1G	0 to 1 bar / 0 to 100 kPa	6.7 bar	1 bar	10 bar / 1 MPa
	A1H ¹⁾	0 to 1.6 bar / 0 to 160 kPa	12 bar	2 bar	18 bar / 1.8 MPa
	A1K	0 to 2 bar / 0 to 200 kPa	12 bar	2 bar	18 bar / 1.8 MPa
	A1Q	0 to 4 bar / 0 to 400 kPa	16.7 bar	4 bar	25 bar / 2.5 MPa
	A1R ¹⁾	0 to 6 bar / 0 to 600 kPa	26.7 bar	10 bar	40 bar / 4 MPa
	A1S	0 to 10 bar / 0 to 1 MPa	26.7 bar	10 bar	40 bar / 4 MPa
	A1T ¹⁾	0 to 16 bar / 0 to 1.6 MPa	26.7 bar	20 bar	40 bar / 4 MPa
	A1V	0 to 20 bar / 0 to 2 MPa	26.7 bar	20 bar	40 bar / 4 MPa
	A1W ¹⁾	0 to 25 bar / 0 to 2.5 MPa	40 bar	40 bar	60 bar / 6 MPa
	A1X	0 to 40 bar / 0 to 4 MPa	40 bar	40 bar	60 bar / 6 MPa
	A3C ¹⁾	-1 to 0 bar / -100 to 0 kPa	6.7 bar	2 bar	10 bar / 1 MPa
	A3E ¹⁾	-1 to 1 bar / -100 to 100 kPa	6.7 bar	2 bar	10 bar / 1 MPa
	A3G ¹⁾	-1 to 3 bar / -100 to 300 kPa	16.7 bar	4 bar	25 bar / 2.5 MPa
	A3K ¹⁾	-1 to 9 bar / -100 to 900 kPa	26.7 bar	10 bar	40 bar / 4 MPa
	A3N ¹⁾	-1 to 15 bar / -0.1 to 1.5 MPa	26.7 bar	20 bar	40 bar / 4 MPa
	D10	0 to 100 mbar / 0 to 10 kPa	2.7 bar	0.1 bar	4 bar / 400 kPa
	D12 ¹⁾	0 to 200 mbar / 0 to 20 kPa	3.3 bar	0.2 bar	5 bar / 500 kPa
	D14	0 to 400 mbar / 0 to 40 kPa	5.3 bar	0.4 bar	8 bar / 800 kPa
	D3W	-20 to 20 mbar / -2 to 2 kPa	2.7 bar	0.2 bar	4 bar / 400 kPa
	D31 ¹⁾	-100 to 100 mbar / -10 to 10 kPa	3.3 bar	0.2 bar	5 bar / 500 kPa
	D38 ¹⁾	-200 to 200 mbar / -20 to 20 kPa	3.3 bar	0.4 bar	5 bar / 500 kPa
	D39 ¹⁾	-300 to 300 mbar / -30 to 30 kPa	5.3 bar	1 bar	8 bar / 800 kPa
PMC131		Order code			

→ For continuation of ordering information of PMC131, see the following page.

1) Span set and calibrated at the factory

PMC131 (continued)

Measuring range; MWP; Nominal value; OPL:					
				Measuring range	MWP (Maximum Working Pressure)
Sensors for gauge pressure					
Q4D	0 to 1.5 psi	40 psi	1.5 psi	60 psi	
Q4F ¹⁾	0 to 5 psi	80 psi	6 psi	120 psi	
Q4H	0 to 15 psi	100 psi	15 psi	150 psi	
Q4K	0 to 30 psi	180 psi	30 psi	270 psi	
Q4N ¹⁾	0 to 50 psi	250 psi	60 psi	375 psi	
Q4R	0 to 150 psi	400 psi	150 psi	600 psi	
Q4S	0 to 300 psi	400 psi	300 psi	600 psi	
Q4T ¹⁾	0 to 500 psi	600 psi	600 psi	900 psi	
V6F ¹⁾	-1.5 to 1.5 psi	50 psi	3 psi	75 psi	
V6N ¹⁾	-15 to 15 psi	100 psi	30 psi	150 psi	
V6R ¹⁾	-15 to 30 psi	250 psi	60 psi	375 psi	
V6S	-15 to 60 psi	250 psi	60 psi	375 psi	
V6V	-15 to 150 psi	400 psi	150 psi	600 psi	
S4N ¹⁾	0 to 50 inH ₂ O	50 psi	3 psi	75 psi	
S4Q ¹⁾	0 to 100 inH ₂ O	80 psi	6 psi	120 psi	
W6N ¹⁾	-15 to 15 inH ₂ O	40 psi	3 psi	60 psi	
W6O ¹⁾	-80 to 80 inH ₂ O	50 psi	6 psi	75 psi	
W6R ¹⁾	-15 to 30 inH ₂ O	50 psi	3 psi	75 psi	
Sensors for absolute pressure					
A2G	0 to 1 bar / 0 to 100 kPa	6.7 bar	1 bar	10 bar / 1 MPa	
A2H ¹⁾	0 to 1.6 bar / 0 to 160 kPa	12 bar	2 bar	18 bar / 1.8 MPa	
A2K	0 to 2 bar / 0 to 200 kPa	12 bar	2 bar	18 bar / 1.8 MPa	
A2Q	0 to 4 bar / 0 to 400 kPa	16.7 bar	4 bar	25 bar / 2.5 MPa	
A2R ¹⁾	0 to 6 bar / 0 to 600 kPa	26.7 bar	10 bar	40 bar / 4 MPa	
A2S	0 to 10 bar / 0 to 1 MPa	26.7 bar	10 bar	40 bar / 4 MPa	
A2T ¹⁾	0 to 16 bar / 0 to 1.6 MPa	26.7 bar	20 bar	40 bar / 4 MPa	
A2V	0 to 20 bar / 0 to 2 MPa	26.7 bar	20 bar	40 bar / 4 MPa	
A2W ¹⁾	0 to 25 bar / 0 to 2.5 MPa	40 bar	40 bar	60 bar / 6 MPa	
A2X	0 to 40 bar / 0 to 4 MPa	40 bar	40 bar	60 bar / 6 MPa	
D20 ¹⁾	0 to 100 mbar / 0 to 10 kPa	3.3 bar	0.2 bar	5 bar / 500 kPa	
D22	0 to 200 mbar / 0 to 20 kPa	3.3 bar	0.2 bar	5 bar / 500 kPa	
D24	0 to 400 mbar / 0 to 40 kPa	5.3 bar	0.4 bar	8 bar / 800 kPa	
R4D ¹⁾	0 to 1.5 psi	50 psi	3 psi	75 psi	
R4F ¹⁾	0 to 5 psi	80 psi	6 psi	120 psi	
R4H	0 to 15 psi	100 psi	15 psi	150 psi	
R4K	0 to 30 psi	180 psi	30 psi	270 psi	
R4N ¹⁾	0 to 50 psi	250 psi	60 psi	375 psi	
R4R	0 to 150 psi	400 psi	150 psi	600 psi	
R4S	0 to 300 psi	400 psi	300 psi	600 psi	
R4T ¹⁾	0 to 500 psi	600 psi	600 psi	900 psi	
PMC131				Complete order code	

1) Span set and calibrated at the factory

PMP131

10	Electrical connection:			
	A1	Plug ISO 4400, M 16, IP 65/NEMA 4X		
	A2	Plug ISO 4400, ½ NPT, IP 65/NEMA 4X		
	A3	5 m cable, IP 68/NEMA 6P		
	A4	Plug M 12, IP 65/NEMA 4X		
20	Process connection:			
	B	Thread ISO 228 G ½, Seal DIN 3852, AISI 304, flush-mounted		
	1	Thread ISO 228 G ½, AISI 304		
	2	Thread ANSI ½ MNPT ¼ FNPT, AISI 304		
	3	Thread ANSI ½ MNPT bore 4 mm, AISI 304		
	4	Thread ISO 228 G ¼, AISI 304		
	5	Thread ANSI ¼ MNPT bore 3.5 mm, AISI 304		
30	Output:			
	0	Analog 4 to 20 mA, SIL		
	D	Analog 4 to 20 mA, SIL, ATEX II 1/2 G EEx ib IIC T6		
	1	Analog 4 to 20 mA, SIL, ATEX II 2 G EEx ib IIC T6		
	5	Analog 4 to 20 mA, SIL, ATEX II 3 G EEx nA II T6		
	2	Switch output PNP, 3-wire		
	3	Switch output PNP, 3-wire, ATEX II 3 G EEx nA II T6		
40	Additional options:			
	1	Without additional equipment		
	S	GL/RINA marine approval		
	2	Final inspection report		
50	Sensor range; MWP; OPL:			
		Sensor range	MWP (maximum working pressure)	OPL (over pressure limit)
		Sensors for gauge pressure		
	A1G	0 to 1 bar / 0 to 100 kPa	2.7 bar	4 bar / 400 kPa
	A1H	0 to 1.6 bar / 0 to 160 kPa	4 bar	6.4 bar / 640 kPa
	A1N	0 to 2.5 bar / 0 to 250 kPa	6.7 bar	10 bar / 1 MPa
	A1Q	0 to 4 bar / 0 to 400 kPa	10.7 bar	16 bar / 1.6 MPa
	A1R	0 to 6 bar / 0 to 600 kPa	16 bar	24 bar / 2.4 MPa
	A1S	0 to 10 bar / 0 to 1 MPa	25 bar	40 bar / 4 MPa
	A1T	0 to 16 bar / 0 to 1.6 MPa	25 bar	64 bar / 6.4 MPa
	A1W	0 to 25 bar / 0 to 2.5 MPa	25 bar	100 bar / 10 MPa
	A1X	0 to 40 bar / 0 to 4 MPa	60 bar	160 bar / 16 MPa
	A1Z	0 to 60 bar / 0 to 6 MPa	60 bar	240 bar / 24 MPa
	A70	0 to 100 bar / 0 to 10 MPa	100 bar	400 bar / 40 MPa
	A71	0 to 160 bar / 0 to 16 MPa	160 bar	600 bar / 60 MPa
	A73	0 to 250 bar / 0 to 25 MPa	250 bar	600 bar / 60 MPa
	A74	0 to 400 bar / 0 to 40 MPa	400 bar	600 bar / 60 MPa
	Q4H	0 to 15 psi	40 psi	60 psi
	Q4K	0 to 30 psi	100 psi	150 psi
	Q4N	0 to 50 psi	160 psi	240 psi
	Q4R	0 to 150 psi	400 psi	600 psi
	Q4S	0 to 300 psi	400 psi	1500 psi
	Q4T	0 to 500 psi	1000 psi	2400 psi
	Q4V	0 to 1000 psi	1000 psi	3600 psi
	Q70	0 to 1500 psi	1500 psi	6000 psi
	Q73	0 to 3000 psi	3000 psi	9000 psi
	Q74	0 to 6000 psi	6000 psi	9000 psi
PMP131		Order code		

→ For continuation of ordering information of PMP131, see the following page.

PMP131 (continued)

				Sensor range; MWP; OPL:		
				Sensor range	MWP (maximum working pressure)	OPL (over pressure limit)
Sensors for absolute pressure						
	A2G	0 to 1 bar / 0 to 100 kPa		2.7 bar	4 bar / 400 kPa	
	A2H	0 to 1.6 bar / 0 to 160 kPa		4 bar	6.4 bar / 640 kPa	
	A2N	0 to 2.5 bar / 0 to 250 kPa		6.7 bar	10 bar / 1 MPa	
	A2Q	0 to 4 bar / 0 to 400 kPa		10.7 bar	16 bar / 1.6 MPa	
	A2R	0 to 6 bar / 0 to 600 kPa		16 bar	24 bar / 2.4 MPa	
	A2S	0 to 10 bar / 0 to 1 MPa		25 bar	40 bar / 4 MPa	
	A2T	0 to 16 bar / 0 to 1.6 MPa		25 bar	64 bar / 6.4 MPa	
	A2W	0 to 25 bar / 0 to 2.5 MPa		25 bar	100 bar / 10 MPa	
	A2X	0 to 40 bar / 0 to 4 MPa		60 bar	160 bar / 16 MPa	
	A2Z	0 to 60 bar / 0 to 6 MPa		60 bar	240 bar / 24 MPa	
	B70	0 to 100 bar / 0 to 10 MPa		100 bar	400 bar / 40 MPa	
	B71	0 to 160 bar / 0 to 16 MPa		160 bar	600 bar / 60 MPa	
	B73	0 to 250 bar / 0 to 25 MPa		250 bar	600 bar / 60 MPa	
	B74	0 to 400 bar / 0 to 40 MPa		400 bar	600 bar / 60 MPa	
	R4H	0 to 15 psi		40 psi	60 psi	
	R4K	0 to 30 psi		100 psi	150 psi	
	R4N	0 to 50 psi		160 psi	240 psi	
	R4R	0 to 150 psi		400 psi	600 psi	
	R4S	0 to 300 psi		400 psi	1500 psi	
	R4T	0 to 500 psi		1000 psi	2400 psi	
	R4V	0 to 1000 psi		1000 psi	3600 psi	
	R70	0 to 1500 psi		1500 psi	6000 psi	
	R73	0 to 3000 psi		3000 psi	9000 psi	
	R74	0 to 6000 psi		6000 psi	9000 psi	
				Complete order code		
PMP131						


PMP135

10	Electrical connection:																																																																																																																																							
	A1 Plug ISO 4400, M 16, IP 65/NEMA 4X A2 Plug ISO 4400, ½ NPT, IP 65/NEMA 4X A3 5 m cable, IP 68/NEMA 6P A4 Plug M 12, IP 65/NEMA 4X																																																																																																																																							
20	Process connection:																																																																																																																																							
	F Clamp ISO 2852, DN 22 (¾"), AISI 316L, 3A, DIN 32676 DN 20 G Tri-Clamp ISO 2852, DN 25 to 38 (1" to 1½"), AISI 316L, 3A, DIN 32676 DN 25 to 40 H Tri-Clamp ISO 2852, DN 40 to 51 (2"), AISI 316L, 3A, DIN 32676 DN 50 M Thread ISO 228, G 1, with metallic sealing taper, AISI 316L, flush-mounted, adapter 52005087 N Thread ISO 228, G 1, with sealing surface for flush-mounted installation, AISI 316L, adapter 52001051 S SMS 1½", PN 25, AISI 316L, 3A																																																																																																																																							
30	Output:																																																																																																																																							
	0 Analog 4 to 20 mA, SIL D Analog 4 to 20 mA, SIL, ATEX II 1/2 G EEx ib IIC T6 1 Analog 4 to 20 mA, SIL, ATEX II 2 G EEx ib IIC T6 5 Analog 4 to 20 mA, SIL, ATEX II 3 G EEx nA II T6 2 Switch output PNP, 3-wire 3 Switch output PNP, ATEX II 3 G EEx nA II T6																																																																																																																																							
40	Additional options:																																																																																																																																							
	1 Without additional equipment C EN10204-3.1 material (wetted) inspection certificate 2 Final inspection report																																																																																																																																							
50	Sensor range; MWP; OPL:																																																																																																																																							
	<table border="1"> <thead> <tr> <th></th> <th>Sensor range</th> <th>MWP (maximum working pressure)</th> <th>OPL (over pressure limit)</th> </tr> </thead> <tbody> <tr> <td colspan="4">Sensors for gauge pressure</td></tr> <tr> <td>A1G</td><td>0 to 1 bar / 0 to 100 kPa</td><td>2.7 bar</td><td>4 bar / 400 kPa</td></tr> <tr> <td>A1H</td><td>0 to 1.6 bar / 0 to 160 kPa</td><td>4 bar</td><td>6.4 bar / 640 kPa</td></tr> <tr> <td>A1N</td><td>0 to 2.5 bar / 0 to 250 kPa</td><td>6.7 bar</td><td>10 bar / 1 MPa</td></tr> <tr> <td>A1Q</td><td>0 to 4 bar / 0 to 400 kPa</td><td>10.7 bar</td><td>16 bar / 1.6 MPa</td></tr> <tr> <td>A1R</td><td>0 to 6 bar / 0 to 600 kPa</td><td>16 bar</td><td>24 bar / 2.4 MPa</td></tr> <tr> <td>A1S</td><td>0 to 10 bar / 0 to 1 MPa</td><td>25 bar</td><td>40 bar / 4 MPa</td></tr> <tr> <td>A1T</td><td>0 to 16 bar / 0 to 1.6 MPa</td><td>25 bar</td><td>64 bar / 6.4 MPa</td></tr> <tr> <td>A1W</td><td>0 to 25 bar / 0 to 2.5 MPa</td><td>25 bar</td><td>100 bar / 10 MPa</td></tr> <tr> <td>A1X</td><td>0 to 40 bar / 0 to 4 MPa</td><td>60 bar</td><td>160 bar / 16 MPa</td></tr> <tr> <td>Q4H</td><td>0 to 15 psi</td><td>40 psi</td><td>60 psi</td></tr> <tr> <td>Q4K</td><td>0 to 30 psi</td><td>100 psi</td><td>150 psi</td></tr> <tr> <td>Q4N</td><td>0 to 50 psi</td><td>160 psi</td><td>240 psi</td></tr> <tr> <td>Q4R</td><td>0 to 150 psi</td><td>400 psi</td><td>600 psi</td></tr> <tr> <td>Q4S</td><td>0 to 300 psi</td><td>400 psi</td><td>1500 psi</td></tr> <tr> <td>Q4T</td><td>0 to 500 psi</td><td>1000 psi</td><td>2400 psi</td></tr> <tr> <td colspan="4">Sensors for absolute pressure</td></tr> <tr> <td>A2G</td><td>0 to 1 bar / 0 to 100 kPa</td><td>2.7 bar</td><td>4 bar / 400 kPa</td></tr> <tr> <td>A2H</td><td>0 to 1.6 bar / 0 to 160 kPa</td><td>4 bar</td><td>6.4 bar / 640 kPa</td></tr> <tr> <td>A2N</td><td>0 to 2.5 bar / 0 to 250 kPa</td><td>6.7 bar</td><td>10 bar / 1 MPa</td></tr> <tr> <td>A2Q</td><td>0 to 4 bar / 0 to 400 kPa</td><td>10.7 bar</td><td>16 bar / 1.6 MPa</td></tr> <tr> <td>A2R</td><td>0 to 6 bar / 0 to 600 kPa</td><td>16 bar</td><td>24 bar / 2.4 MPa</td></tr> <tr> <td>A2S</td><td>0 to 10 bar / 0 to 1 MPa</td><td>25 bar</td><td>40 bar / 4 MPa</td></tr> <tr> <td>A2T</td><td>0 to 16 bar / 0 to 1.6 MPa</td><td>25 bar</td><td>64 bar / 6.4 MPa</td></tr> <tr> <td>A2W</td><td>0 to 25 bar / 0 to 2.5 MPa</td><td>25 bar</td><td>100 bar / 10 MPa</td></tr> <tr> <td>A2X</td><td>0 to 40 bar / 0 to 4 MPa</td><td>60 bar</td><td>160 bar / 16 MPa</td></tr> <tr> <td>R4H</td><td>0 to 15 psi</td><td>40 psi</td><td>60 psi</td></tr> <tr> <td>R4K</td><td>0 to 30 psi</td><td>100 psi</td><td>150 psi</td></tr> <tr> <td>R4N</td><td>0 to 50 psi</td><td>160 psi</td><td>240 psi</td></tr> <tr> <td>R4R</td><td>0 to 150 psi</td><td>400 psi</td><td>600 psi</td></tr> <tr> <td>R4S</td><td>0 to 300 psi</td><td>400 psi</td><td>1500 psi</td></tr> <tr> <td>R4T</td><td>0 to 500 psi</td><td>1000 psi</td><td>2400 psi</td></tr> </tbody> </table>					Sensor range	MWP (maximum working pressure)	OPL (over pressure limit)	Sensors for gauge pressure				A1G	0 to 1 bar / 0 to 100 kPa	2.7 bar	4 bar / 400 kPa	A1H	0 to 1.6 bar / 0 to 160 kPa	4 bar	6.4 bar / 640 kPa	A1N	0 to 2.5 bar / 0 to 250 kPa	6.7 bar	10 bar / 1 MPa	A1Q	0 to 4 bar / 0 to 400 kPa	10.7 bar	16 bar / 1.6 MPa	A1R	0 to 6 bar / 0 to 600 kPa	16 bar	24 bar / 2.4 MPa	A1S	0 to 10 bar / 0 to 1 MPa	25 bar	40 bar / 4 MPa	A1T	0 to 16 bar / 0 to 1.6 MPa	25 bar	64 bar / 6.4 MPa	A1W	0 to 25 bar / 0 to 2.5 MPa	25 bar	100 bar / 10 MPa	A1X	0 to 40 bar / 0 to 4 MPa	60 bar	160 bar / 16 MPa	Q4H	0 to 15 psi	40 psi	60 psi	Q4K	0 to 30 psi	100 psi	150 psi	Q4N	0 to 50 psi	160 psi	240 psi	Q4R	0 to 150 psi	400 psi	600 psi	Q4S	0 to 300 psi	400 psi	1500 psi	Q4T	0 to 500 psi	1000 psi	2400 psi	Sensors for absolute pressure				A2G	0 to 1 bar / 0 to 100 kPa	2.7 bar	4 bar / 400 kPa	A2H	0 to 1.6 bar / 0 to 160 kPa	4 bar	6.4 bar / 640 kPa	A2N	0 to 2.5 bar / 0 to 250 kPa	6.7 bar	10 bar / 1 MPa	A2Q	0 to 4 bar / 0 to 400 kPa	10.7 bar	16 bar / 1.6 MPa	A2R	0 to 6 bar / 0 to 600 kPa	16 bar	24 bar / 2.4 MPa	A2S	0 to 10 bar / 0 to 1 MPa	25 bar	40 bar / 4 MPa	A2T	0 to 16 bar / 0 to 1.6 MPa	25 bar	64 bar / 6.4 MPa	A2W	0 to 25 bar / 0 to 2.5 MPa	25 bar	100 bar / 10 MPa	A2X	0 to 40 bar / 0 to 4 MPa	60 bar	160 bar / 16 MPa	R4H	0 to 15 psi	40 psi	60 psi	R4K	0 to 30 psi	100 psi	150 psi	R4N	0 to 50 psi	160 psi	240 psi	R4R	0 to 150 psi	400 psi	600 psi	R4S	0 to 300 psi	400 psi	1500 psi	R4T	0 to 500 psi	1000 psi	2400 psi
	Sensor range	MWP (maximum working pressure)	OPL (over pressure limit)																																																																																																																																					
Sensors for gauge pressure																																																																																																																																								
A1G	0 to 1 bar / 0 to 100 kPa	2.7 bar	4 bar / 400 kPa																																																																																																																																					
A1H	0 to 1.6 bar / 0 to 160 kPa	4 bar	6.4 bar / 640 kPa																																																																																																																																					
A1N	0 to 2.5 bar / 0 to 250 kPa	6.7 bar	10 bar / 1 MPa																																																																																																																																					
A1Q	0 to 4 bar / 0 to 400 kPa	10.7 bar	16 bar / 1.6 MPa																																																																																																																																					
A1R	0 to 6 bar / 0 to 600 kPa	16 bar	24 bar / 2.4 MPa																																																																																																																																					
A1S	0 to 10 bar / 0 to 1 MPa	25 bar	40 bar / 4 MPa																																																																																																																																					
A1T	0 to 16 bar / 0 to 1.6 MPa	25 bar	64 bar / 6.4 MPa																																																																																																																																					
A1W	0 to 25 bar / 0 to 2.5 MPa	25 bar	100 bar / 10 MPa																																																																																																																																					
A1X	0 to 40 bar / 0 to 4 MPa	60 bar	160 bar / 16 MPa																																																																																																																																					
Q4H	0 to 15 psi	40 psi	60 psi																																																																																																																																					
Q4K	0 to 30 psi	100 psi	150 psi																																																																																																																																					
Q4N	0 to 50 psi	160 psi	240 psi																																																																																																																																					
Q4R	0 to 150 psi	400 psi	600 psi																																																																																																																																					
Q4S	0 to 300 psi	400 psi	1500 psi																																																																																																																																					
Q4T	0 to 500 psi	1000 psi	2400 psi																																																																																																																																					
Sensors for absolute pressure																																																																																																																																								
A2G	0 to 1 bar / 0 to 100 kPa	2.7 bar	4 bar / 400 kPa																																																																																																																																					
A2H	0 to 1.6 bar / 0 to 160 kPa	4 bar	6.4 bar / 640 kPa																																																																																																																																					
A2N	0 to 2.5 bar / 0 to 250 kPa	6.7 bar	10 bar / 1 MPa																																																																																																																																					
A2Q	0 to 4 bar / 0 to 400 kPa	10.7 bar	16 bar / 1.6 MPa																																																																																																																																					
A2R	0 to 6 bar / 0 to 600 kPa	16 bar	24 bar / 2.4 MPa																																																																																																																																					
A2S	0 to 10 bar / 0 to 1 MPa	25 bar	40 bar / 4 MPa																																																																																																																																					
A2T	0 to 16 bar / 0 to 1.6 MPa	25 bar	64 bar / 6.4 MPa																																																																																																																																					
A2W	0 to 25 bar / 0 to 2.5 MPa	25 bar	100 bar / 10 MPa																																																																																																																																					
A2X	0 to 40 bar / 0 to 4 MPa	60 bar	160 bar / 16 MPa																																																																																																																																					
R4H	0 to 15 psi	40 psi	60 psi																																																																																																																																					
R4K	0 to 30 psi	100 psi	150 psi																																																																																																																																					
R4N	0 to 50 psi	160 psi	240 psi																																																																																																																																					
R4R	0 to 150 psi	400 psi	600 psi																																																																																																																																					
R4S	0 to 300 psi	400 psi	1500 psi																																																																																																																																					
R4T	0 to 500 psi	1000 psi	2400 psi																																																																																																																																					
PMP135				Complete order code																																																																																																																																				

Accessories

Welding neck with sealing taper


- Welding neck for flush-mounted installation of the process connection G1 A with metallic sealing taper (PMP135, version M)
Material: AISI 316L (1.4435)
Order number: 52005087
- with inspection certificate 3.1
Order number: 52010171

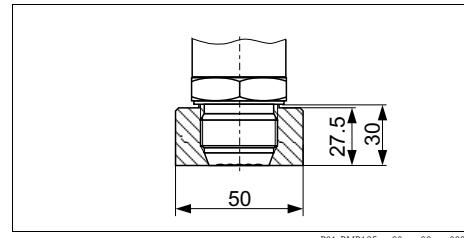

- Pressure sensor dummy for welding the welding neck without any problems with order number 52005087 or 52010171
Material: CuZn
Order number: 52005272


Welding neck with sealing surface

- Welding neck for flush-mounted installation of the process connection G1 A with sealing surface (PMP135, version N)
Material: AISI 316L (1.4435)
Gasket (enclosed): silicone O-ring
Order number: 52001051
- Optional with inspection certificate 3.1
Order number: 52011896

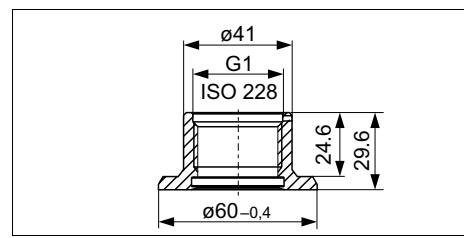


Plug-in jack

- Plug-in jack M 12x1, straight
Self-made connection to M 12x1 housing plug
Material: Handle body PA; Coupling nut CuZn, nickel-plated, degree of protection (inserted): IP 67
Order number: 52006263

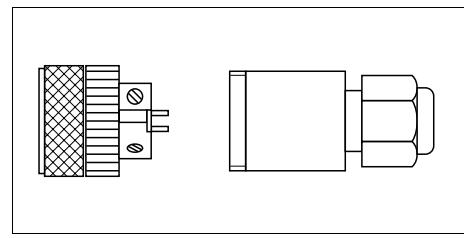

Plug-on display PHX20/ PHX21

- 4-digit red LED display for looping into 4 to 20 mA circuit via elbow plug
DIN 43650, rotatable in 90° steps, programmable via 2 keys
Display range: -1999 to +9999
Degree of protection: IP 65
Material: Housing Pa6 GF30, front screen PMMA
Voltage drop: ≤5 V (corresponds to max. 250 Ω load)
Approval for PHX21: ATEX II 2G
Order number PHX20: 52022914
Order number PHX21: 52022915

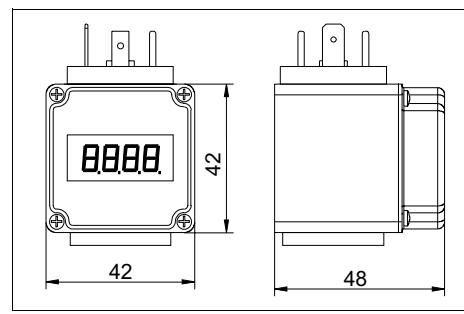

Documentation

Field of Activities	■ Pressure measurement, powerful measuring devices for process pressure, differential pressure, level and flow: FA004P/00/en
Technical Information	■ EMC test procedures TI241F/00/en
Operating Instructions	■ Cerabar T PMC131: KA085P/00/a3 ■ Cerabar T PMP131: KA103P/00/a3 ■ Cerabar T PMP135: KA198P/00/a3
Functional Safety Manual (SIL)	■ Cerabar T PMP131, PMP135: SD160P/00/en
Safety Instructions	Cerabar T PMC131 ■ ATEX II 3 G EEx nA II T4: XA191P/00/a3 Cerabar T PMP131 ■ ATEX II 1/2 G or 2 G EEx ib IIC T6: XA142P/00/a3 ■ ATEX II 3 G EEx nA II T6: XA191P/00/a3 Cerabar T PMP135 ■ ATEX II 1/2 G or 2 G EEx ib IIC T6: XA142P/00/a3 ■ ATEX II 3 G EEx nA II T6: XA191P/00/a3

International Head Quarter

Endress+Hauser
GmbH+Co. KG
Instruments International
Colmarer Str. 6
79576 Weil am Rhein
Deutschland

Tel. +49 76 21 9 75 02
Fax +49 76 21 9 75 34 5
www.endress.com
info@ii.endress.com

Endress+Hauser 
People for Process Automation